Order-No.: DD+DIS360.00E

1 Piece UHLRD MA1

December 2000

Field Service Bulletin No. 45 for

ADC Compact

Type 5145 / 100/101/140

Type 5145 / 200/201/240

Classification			When		
Safety relevant	Reliability	New function	Immediately	Next service	As required
	X				X

New material for scan rollers introduced (CM+9.5145.2650.1)

Problem

The image may show white horizontal stripes (in fast scan direction).

Reason

The surface of the IP may show black stripes caused by diffusion at the scan rollers. This was noticed especially with new machines. The effect diminishes when the digitizer has been in use for several months.

If this abrasion stays on the scan rollers for a longer time, the used IPs may become damaged (chemical changes of the material).

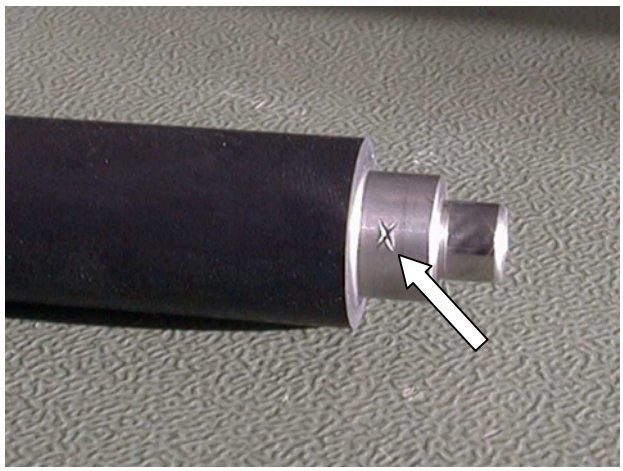

Solution

Exchange the scan rollers. A new material for the scan rollers has been introduced.
These altered scan rollers are marked with an "X", see figure beside.

Order number:

CM+9.5145.2650.1	Scan rollers with new material

If the IPs of a system are exchanged because of the damages described above, it is highly recommended to exchange the scan rollers as well.

Please file this document in section 13 of your Technical Documentation DD+DIS197.00E.

printed in Germany

AGFA